

LIMITED SLIP AXLE MOAN/GROAN NOISE DURING LOW SPEED TURNING MANEUVERS

TSB 06-12-11

FORD:

2005-2006 Mustang

This article supersedes TSB **05-21-2** to update the vehicle model years and service parts.

ISSUE

Some 2005-2006 Mustang GT vehicles equipped with the 8.8 inch limited slip axle may exhibit a moan/groan noise when making low speed turns.

ACTION

First, verify the concern. Turn the wheel fully to the right or the left and then accelerate the vehicle. If the concern is verified to be in the rear axle, replace the limited slip clutch pack.

SERVICE PROCEDURE

Install the new limited slip clutch pack kit following the procedures in Section 205-02B (Differential Carrier Removal and Differential Case/Ring Gear Disassembly) of the appropriate Mustang Workshop Manual.

NOTE

ONLY USE THE WORKSHOP MANUAL STEPS NEEDED FOR REPLACEMENT OF THE CLUTCH PACK.

Installation Tips

- The clutch packs in the service kit DO NOT need to be shimmed. The clutch pack kit contains pre-measured shims

- Soak the new clutch packs in Motorcraft Additive Friction Modifier (XL-3) for 15 minutes prior to installation
- Refill the axle with 4 oz. (118 ml) of Motorcraft Additive Friction Modifier (XL-3) and the necessary amount of Rear Axle Lubricant Motorcraft SAE 75W-140 Synthetic Rear Axle Lubricant (XY-75W140-QL) to the level shown in the Workshop Manual

PART NUMBER	PART NAME
3L1Z-4947-BC	Clutch Pack Kit
XL-3	Motorcraft Additive Friction Modifier
XY-75W140-QL	Motorcraft SAE 75W-140 Synthetic Rear Axle Lubricant

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
061211A	2005-2006 Mustang: Install The Limited Slip Clutch Pack. (Do Not Use With 4205A, 4205A4)	3.3 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
4947	D4

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.